

TI_2124: Reworking Combi-Duo electric left hinged 2/1



iCombi Pro / Classic



12/10/2021

Reason:

The bend on the Combi-Duo kit for left hinged units is too long by 17 mm [2/3 inch].

Rework is necessary for units manufactured before 30/09/2021.

Affected components

Combi-Duo electric left hinged (manufactured before 30/09/2021):


Article number	Unit size
60.74.725	6-2/1 10-2/1

Repair/modification:

NOTICE

The rework only affects kits produced before 30 September 2021.

If the Combi-Duo is used in conjunction with left hinged units, the bend must be shortened by 17mm.

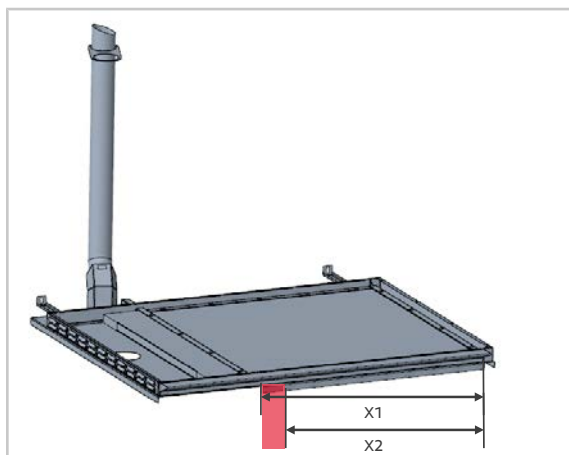

Dimensions	mm [inches]
X1 (Actual)	711 mm [28 inch]
X2 (target)	694 mm [27 1/3 inch]