

TI\_2407: New alternative control board (CPU board)

 iVario

 ---

 ---

 18.06.2024

Topic

We would like to inform you that, since 03/06/2024, we have been using a new control board, Part no.: 42.00.251P as an alternative to the existing control board. This board is used exclusively for newly produced units and can only be operated with software version LMX-2.13.10 or higher.

In the case of service parts, you will continue to receive the usual board.


Affected product/accessories

- iVario
- 2-XS
- iVario Pro
- 2-S
  - L
  - XL

Affected components

| Component     | Article number |
|---------------|----------------|
| Control board | 42.00.251P     |

Usual control board

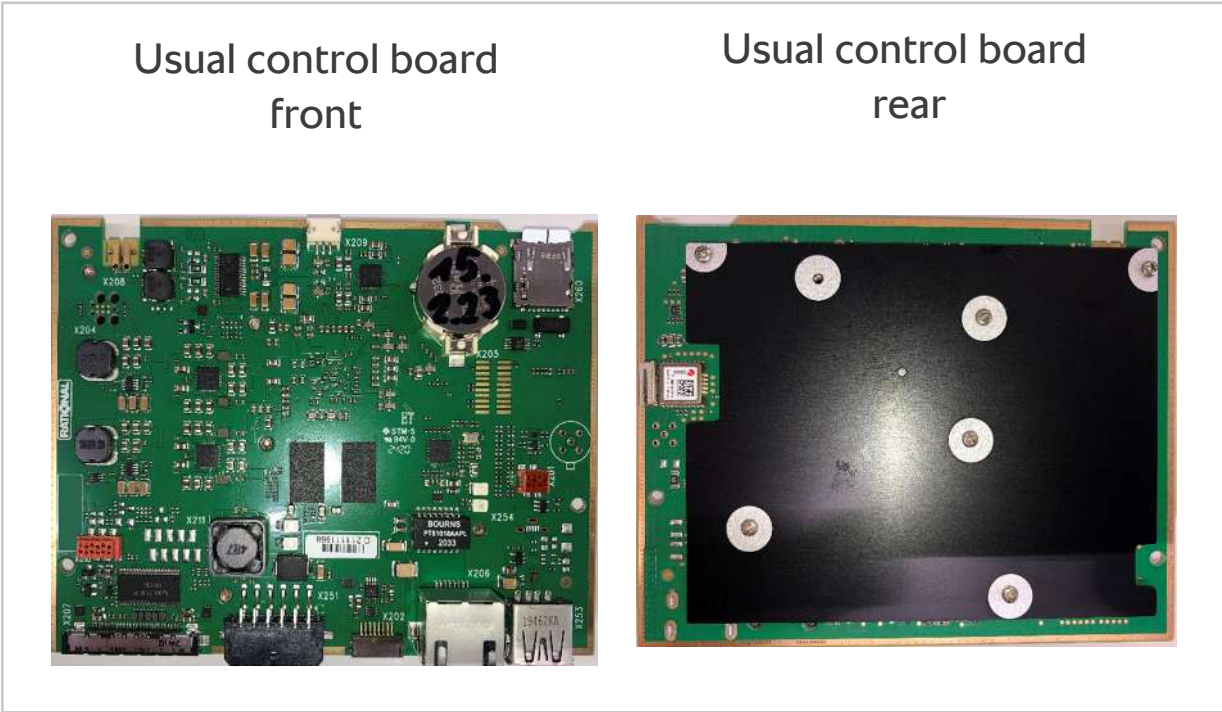


## New alternative control board

New alternative control  
board front



New alternative control  
board rear

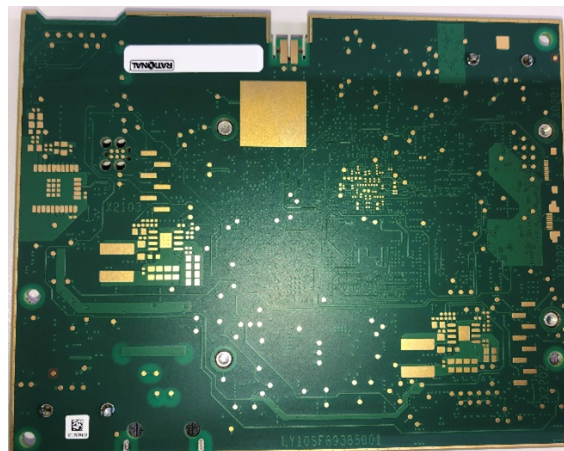

## General information

Both variants of the control board are now installed ex works. Only the previous usual control board will continue to be sent as a service part. This is compatible during service work. It is not possible to convert the new alternative control board in other units (in the event of service) and the board must therefore always be replaced in this case.

Both control boards can be operated as usual with the unit software provided.

### NOTE:

There are no LEDs for error analysis on the new alternative control board. The existing Reset-to-Spare Part software cannot be used on the new control board either.

In the event of a fault, please contact RATIONAL Service and, if a replacement is required, always return the faulty control boards to RATIONAL, describing the fault as precisely as possible.

### NOTE:

No further action is required.