

MI_2503: HEPA particulate filter kit - removal and installation



UltraVent Plus



15 min



Standard



02/04/2025

Topic

The information describes the removal and installation of the HEPA particulate filter set installed in an UltraVent Plus.

Affected product/accessories

UltraVent Plus for:

- iCombi Pro
- iCombi Classic
- iHexagon

Required tool

- Standard

Required components

- 60.75.210P (HEPA particulate filter)

General information

NOTICE


Enter the installation of the component on the service level ("Component replacement" tab). This is an integral part of the maintenance history.

Target group

Installation, inspection, maintenance and repair work must only be carried out by trained technicians and technicians authorised by the manufacturer. In order to prevent accidents or damage, the manufacturer recommends that technicians attend training and safety instructions.

NOTICE! You can find more information in the installation manual.

Installation position

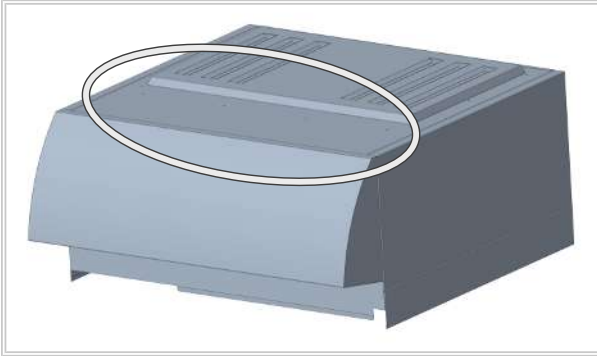

Safety instructions

NOTICE


Observe regional and country-specific safety and testing regulations

The relevant regional, country-specific safety and testing regulations apply to all work on RATIONAL units. These regulations may vary by region and are country-specific and are therefore not listed separately in this document.


The technician is responsible for complying with these regulations.

Work steps - Removal of the old HEPA particulate filter


- ✓ The cooking system is disconnected from the power.
- 1. Remove the impact filters and the electrical box cover.

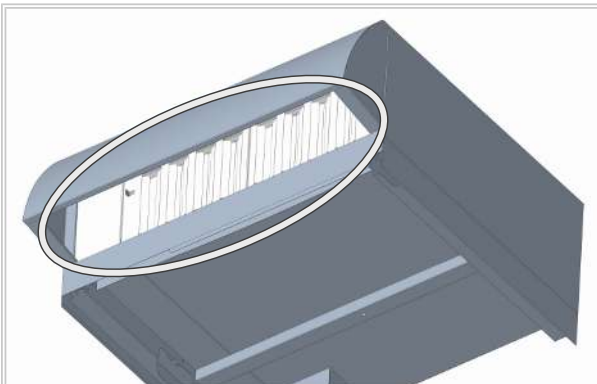


2. Loosen the 4 screws from the backlog.

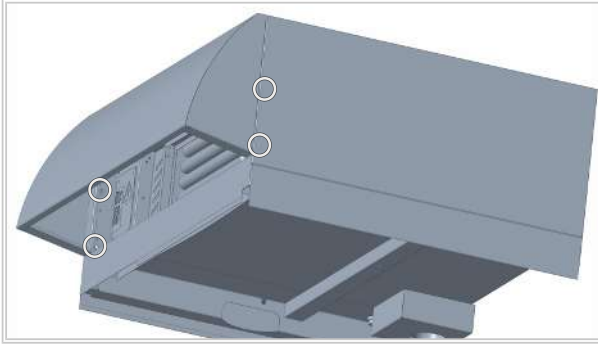

3. Unhook and remove the backlog upwards.

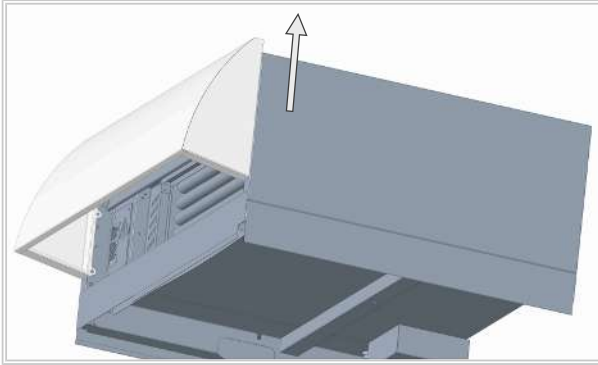


4. Loosen the 4 screws from the filter drawer.

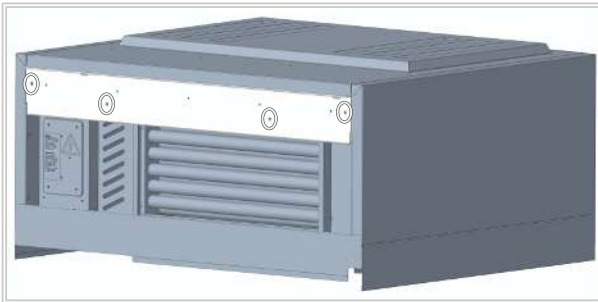


5. Carefully pull out the complete filter drawer to the front and place the filter drawer upside down on a free surface.


CAUTION! Make sure that the filter drawer does not fall down!

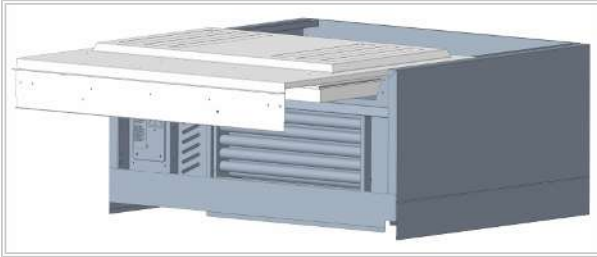

6. Loosen the 6 screws of the UVP press-on frame HEPA filter and remove it.

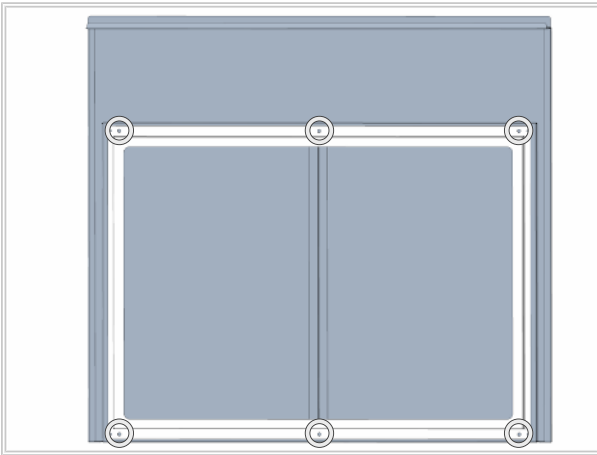

7. Remove the two old HEPA particulate filters.

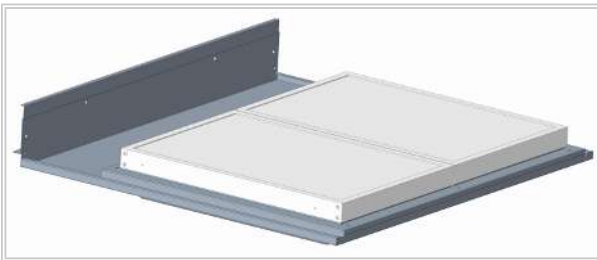


>> The removal is complete.

Work steps - Installation of the new HEPA particulate filter

- ✓ The cooking system is disconnected from the power.

1. Installation is carried out in the reverse order of steps 1 - 7 of removal. When inserting the new HEPA particulate filters, make sure that the sealing tape (1) lies completely on the lid.

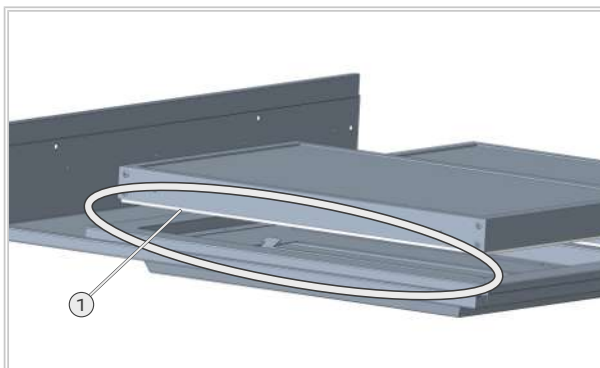

2. When the installation is complete, switch on the unit.
 3. For the iCombi Pro, correctly enter the component replacement in the service level under "General" - tab "Component replacement" - "UV-F - Ultra-Vent filter" to reset the operating time of the HEPA particulate filter.
NOTICE! In the case of Combi-Duo, this component replacement must be entered for both units.
- >> Installation is complete.

