

TI_2203: Availability of SSR power semiconductors



See Affected product/accessories







07/03/2022

Subject

Due to the tense supply situation for electrical components on a global level, from March 2022, heat sinks Quad-SSR cpl. will no longer be installed for iCombi 6-2/3, 6-1/1 and iVario 2-XS, 2-S, L and X L.

Affected product/accessories

iCombi Electric

- 6-2/3
- 6-1/1


iVario

- 2-XS
- 2-S
- L
- XL

General information

Kit of components installed until February 2022:

- iCombi heat sink Quad-SSR Art. no.:40.06.052

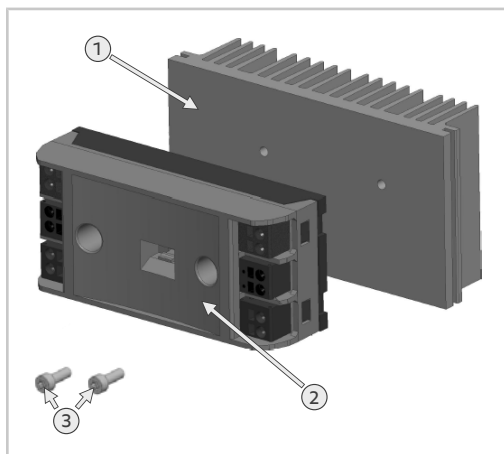


1	Heat sink small Quad-SSR	40.06.051
2	Power semiconductor SSR 4-pin 25 A (Quad)	40.05.670P
3	Cylinder screw Torx T20 M4x12	10.00.061

The power semiconductor SSR 4 pin 24A Art. no.: 40.05.670P can still be purchased in small quantities as a service part.

Article numbers of the components installed up to February 2022:

- iVario

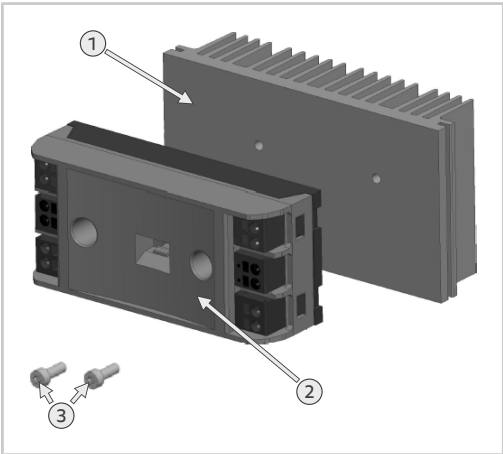


1	Heat sink small Quad-SSR for 2-XS and 2-S	40.06.028P
1	Heat sink small Quad-SSR for L and XL	40.06.428P
2	Power semiconductor SSR 4-pin 25 A (Quad)	40.05.670P
2	Power semiconductor SSR	40.05.840P
3	Cylinder screw Torx T20 M4x12	10.02.263P


The power semiconductor SSR 4 pin 24A Art. no.: 40.05.670P can still be purchased in small quantities as a service part.

From March 2022, the following components will be installed:

- a. Power semiconductor SSR screwable

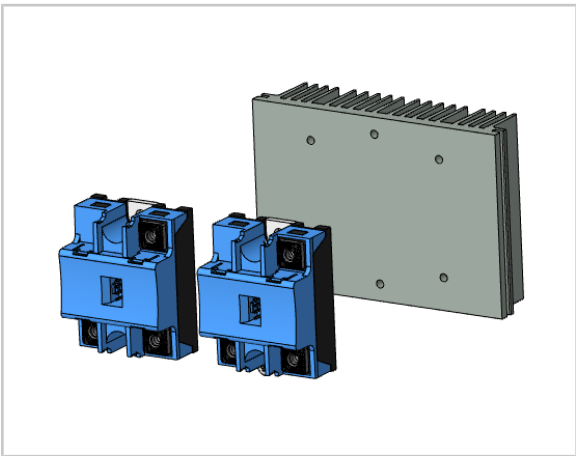

- b. Power semiconductor SSR pluggable

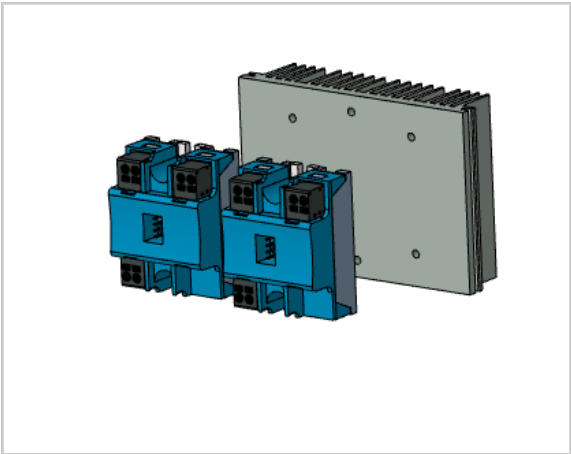

NOTE:

The serial number in the service parts catalogue indicates which power semiconductors are required for your unit in the event of service.

The following components are available here:

- iCombi 6-2/3

Component	Article number
Power semiconductor SSR	40.01.589P or 40.05.840P
Heat sink small SSR	40.04.795P

- iCombi 6-1/1

Component	Article number
Power semiconductor SSR	40.01.589P or 40.05.840P
Heat sink small SSR	40.03.931P

- iVario 2-XS, 2-S, L and XL

Component	Article number
Power semiconductors SSR for 2-XS, 2-S, L and XL	40.01.589P
Heat sink SSR for 2-XS and 2-S	40.06.028P
Heat sink SSR for L and XL	40.06.428P

This has no impact on the function of the units.

It is possible that more component changes will take place once the supply situation has relaxed.